


WELLFLEET

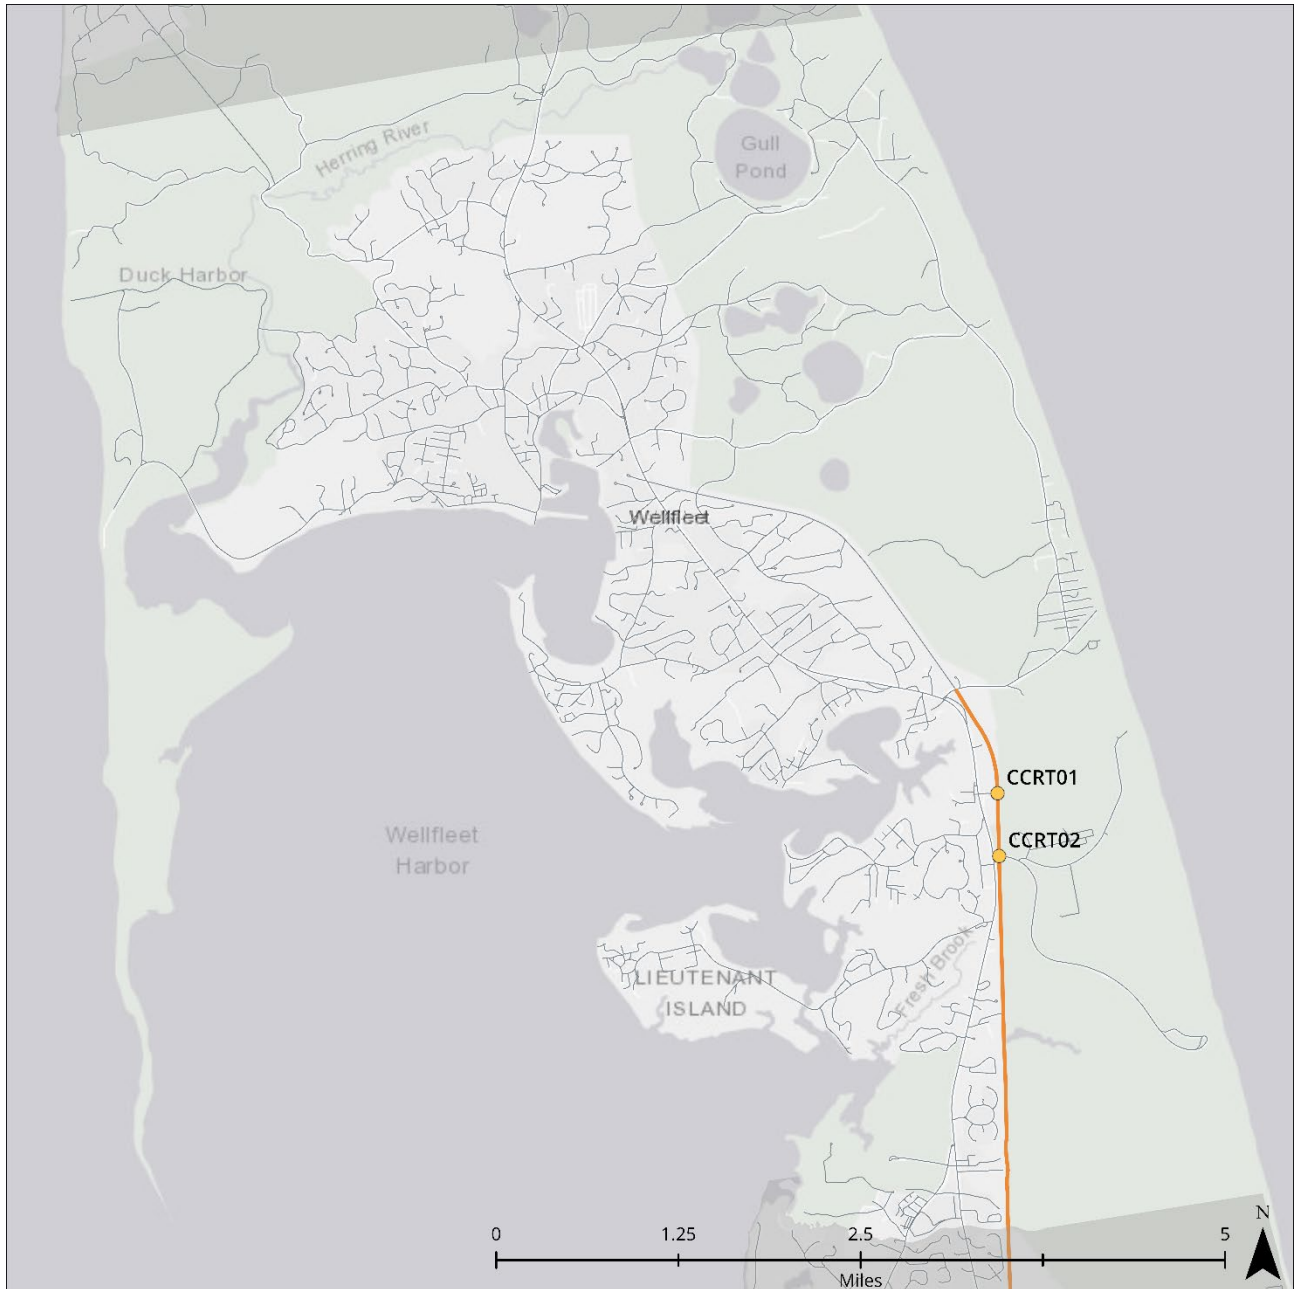

Cape Cod Rail Trail #1 (Cemetery Road)

CRASH HISTORY SURROUNDING THE CROSSING

No crash history surrounding the crossing.

CEMETARY ROAD, ROAD SAFETY FEATURES

Dir.	Advance Warning Signs	Bike Trail Crossing Signs	Advance Pavement Markings	Control Type	Shark Teeth Yield Markings	Crosswalk Markings	Median Between Crosswalk	Additional Safety Features	Visibility of Bike Trails	Grade	Posted Speed Limit	Avg. Lane and Shoulder Width
WB	None	None	None	None	None	None	No	None	Good	None	None	11/none (one lane)
EB	None	None	None	None	None	None	No	None	Good	Slight Down hill	None	13/none (one lane)

*Green wayfinding signage present as well.

CAPE COD RAIL TRAIL BIKEWAY SAFETY FEATURES

Dir.	Control Type	Condition of Signage	Pavement Markings	Advance Warning Signs	Sight Distance	Width at Intersection	Median Approaching Intersection	Other Features	Crossing Distance	Crosswalk Style	Crosswalk Width	Tactile Warning Plates
NB	None	None	None	No	Good	10'	No	None	15'	None	10'	None
SB	None	None	None	No	Good	10'	No	None	15'	None	10'	None

EXTRA NOTES

Very rural location with little traffic. Cemetery Road is a dirt road.

IMAGES

Figure 63: Road Approach (Only Paved on One Side)



Figure 64: Path Approach to Crossing



Cape Cod Rail Trail #2 (Marconi Beach Road)

CRASH HISTORY SURROUNDING THE CROSSING

Crash Date	Crash Time	Crash Severity	Non-Motorist Action (All Persons)	Light Conditions	Weather Conditions
10/18/2015	4:50 PM	Property damage only (none injured)	None	Dusk	Clear
6/20/2016	4:13 PM	Property damage only (none injured)	None	Daylight	Clear
6/21/2016	6:00 PM	Property damage only (none injured)	None	Daylight	Clear
8/5/2016	1:54 PM	Property damage only (none injured)	None	Daylight	Clear
8/4/2016	2:09 PM	Non-fatal injury	None	Daylight	Clear
9/17/2016	4:21 PM	Property damage only (none injured)	None	Daylight	Clear
6/2/2017	7:03 AM	Non-fatal injury	None	Daylight	Clear
9/15/2017	12:45 PM	Property damage only (none injured)	None	Daylight	Clear
6/1/2019	4:30 PM	Non-fatal injury	P1: Pedestrian	Daylight	Cloudy/Fog, smog, smoke

MARCONI BEACH ROAD, ROAD SAFETY FEATURES

Dir.	Advance Warning Signs	Bike Trail Crossing Signs	Advance Pavement Markings	Control Type	Shark Teeth Yield Markings	Crosswalk Markings	Median Between Crosswalk	Additional Safety Features	Visibility of Bike Trail	Grade	Posted Speed Limit	Avg. Lane and Shoulder Width
WB	Good	Good*	Poor	None	None	Poor	No	RRFB, and pavement grooves (to encourage reduced	Good	None	None	13'/none

Wellfleet – Cape Cod Rail Trail

								vehicle speed)				
EB	Good	Good*	Fair	None	None	Fair	No	RRFB and pavement grooves	Good	None	None	16'/none

*Green wayfinding signage present as well.

** Additionally, there is a State Law Stop Sign (on post with Bike Trail Crossing Signs)

CAPE COD RAIL TRAIL BIKEWAY SAFETY FEATURES

Dir.	Control Type	Condition of Signage	Pavement Markings	Advance Warning Signs	Sight Distance	Width at Intersection	Median Approaching Intersection	Other Features	Crossing Distance	Crosswalk Style	Crosswalk Width	Tactile Warning Plates
NB	Stop	Good	Fair	Yes	Good	13'	Yes	RRFB (Button)	35'	Standard w/ yellow paint	14'	None
SB	Stop	Good	Fair	Yes	Good	13'	Yes	RRFB (Button)	35'	Standard w/ yellow paint	14'	None

EXTRA NOTES

Beach road, increased traffic

IMAGES

Figure 65: Grooves in Pavement Help Slow Traffic and Draw Attention to Crossing



Figure 66: Faded Paint is Used on the Crosswalk. Note the RRFBs.

